

In the Matter of:

C. F. L. Decker
For the Commission

APPENDIX

APPENDIX TO AN ORDER OF THE KENTUCKY PUBLIC SERVICE
COMMISSION IN CASE NO. 92-095 DATED 4/3/92

Commonwealth of Kentucky
Public Service Commission

UTILITY REINSPECTION REPORT

Forest Hills Developers, Inc.
Louisville, Kentucky

On February 20, 1992, a reinspection of Forest Hills Developers, Inc.'s wastewater treatment system serving the Forest Hills Subdivision was conducted. The purpose of this reinspection was to see what progress, if any, had been made to date on the improvements or corrections recommended in the Public Service Commission's staff reinspection report dated October 14, 1991. The proposed improvements and corrections and their current status are as follows:

1. The scum behind the baffle in the clarifier needs to be removed. (807 KAR 5:071, Section 7,1)

Current Status: Still needs to be corrected

2. One belt on blower/motor unit No. 2 needs to be replaced. (807 KAR 5:071, Section 7,1)

Current Status: Still needs to be corrected

3. A flow meter needs to be installed. (807 KAR 5:071, Section 7,1)

Current Status: Still needs to be corrected

4. An outside switch is needed for the fan in the chlorine room. (807 KAR 5:071, Section 7,4)

Current Status: Still needs to be corrected.

5. Lagoon No. 2 is high in sludge deposits. Both Lagoon No. 1 and No. 2 need to be closely monitored for overloading conditions. Before overloading occurs the lagoon should be dredged. (807 KAR 5:071, Section 7,1)

Current Status: Lagoons No. 1 and No. 2 have become overloaded and need to be dredged.

6. The lagoon impoundment bank needs to be inspected for muskrat damage and repaired if necessary. (807 KAR 5:071, Section 7,1)

Current Status: Is still needed

7. The sludge deposits in the stream behind Doss High School need to be removed. (807 KAR 5:071, Section 7,1)

Current Status: Still needs to be corrected.

8. The skimmer in the clarifier next to the aeration basin needs to be adjusted to water surface level. (807 KAR 5:071, Section 7,1)

Current Status: The skimmer is now at water surface level.

9. The bar screen for the aeration basin needs to be improved to provide adequate protection for the plant. (807 KAR 5:071, Section 7,1)

Current Status: Still needs to be corrected.

10. The pump out in the clarifier needs to be repaired. (807 KAR 5:071, Section 7,1)

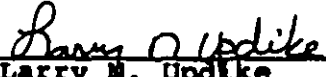
Current Status: The repair of the pump has been made.

11. The sludge deposits removed from Lagoon No. 2 and stored in the plant area need to be disposed of properly. (807 KAR 5:071, Section 7,1)

Current Status: Still needs to be corrected.

In addition, the exhaust fan in the room housing the chlorination unit needs to be repaired and put in service and one pump at the Pikes Peak Lift Station needs to be repaired and put in service.

Submitted,
February 21, 1992


Larry M. Updike
Utility Investigator

eh